





Load Meter

Blue Arrow CLY-ASP Dynamometer with Handheld Display



Wireless PII indicator

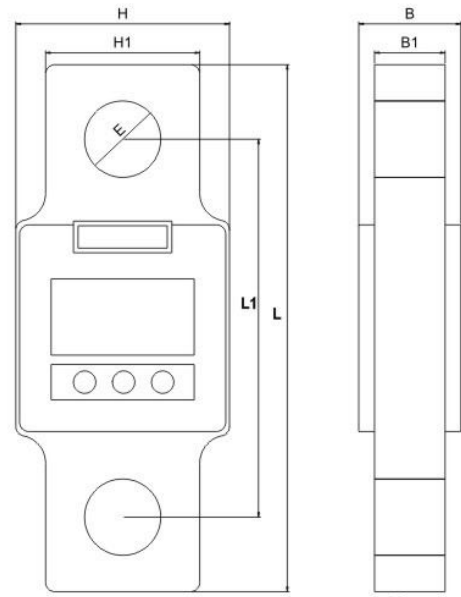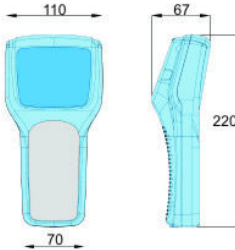

unit :mm



Features

- Sturdy & portable wireless dynamometer
- Alloy steel with good quality for larger capacity
- More convenient in application with hand-held PII wireless indicator
- Peak function to record the largest weight value
- Low battery indication on both load cell and PII indicator

Technical Specifications

Accuracy: 0.1%F.S.
 Time to Stable Reading: ≤8s
 Maximum Safe Load: 150%F.S.
 Ultimate Overload: 500%F.S.
 Overload Alarm: 100%F.S.+9e
 Operating Temperature: -10°C ~ 40°C
 Storage Temperature: -20°C ~ 60°C

Max Capacity	Division	Weight	L	L1	H	H1	B	B1	E
3000kg	1kg	3kg	220	170	115	50	55	38	26
5000kg	2kg	4kg	235	177	115	56	55	38	31
10000kg	5kg	6kg	283	203	115	83	55	38	41
20000kg	10kg	14kg	349	237	115	115	73	56	57
30000kg	10kg	19kg	410	270	120	120	84	67	71

Distributor (US and Canada)
Optoco Inc.
 600 - 2498 West 41st Ave
 Vancouver, BC, V6M 2A7
 Tel: 778-706-6933
 Email: info@optoco.ca
 Web: www.crane-scale.com

Specifications are subject to change without notice.